



Display

Date: **November 29, 1999**

Model: **BVM-D9H1U, BVM-D9H5U**

Subject: **SLOW STARTUP WHEN DC-POWERED**

Serial No: **2,000,001–2,000,160 (BVM-D9H1U)**
2,000,001–2,000,163 (BVM-D9H5U)

DESCRIPTION

When the unit is DC-powered by a lithium battery (BP-L90, 90A, 60 and 60A), it takes more than 30 seconds to start up; when powered by an AC-pack, startup is normal. To correct this condition, replace former (4.7kΩ) resistor R1605 on the D board (side A, zone A-1) with the new 10kΩ part. (See Figure 1.)

PARTS REQUIRED

| Part No. | Description | Qty. |
|--------------|-------------------------|------|
| 1-208-806-11 | Res, Chip, 10kΩ (R1605) | 1 |

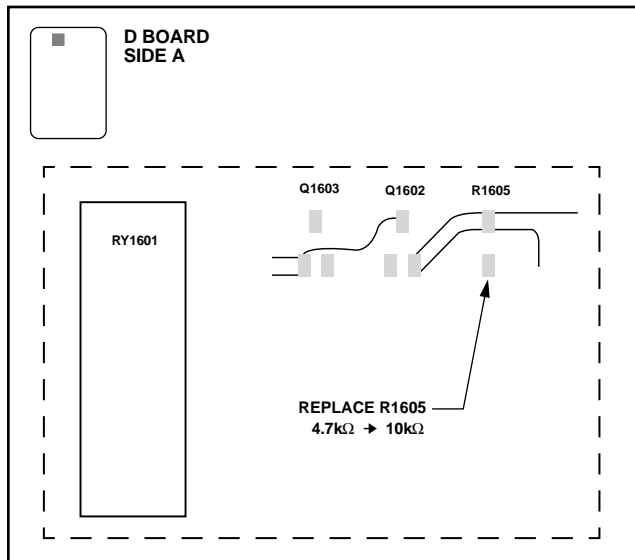


Figure 1