



Display

Date: **March 9, 1998**

Subject: **MOMENTARY HORIZONTAL NOISE**

Model: **PVM-8040, PVM-8041Q, PVM-8044Q**
PVM-8043MD, BVM-8044QD

Serial No: **2,000,001–2,002,400 (BVM-8044QD)**
2,000,001–2,019,350 (PVM-8040)
2,000,001–2,011,750 (PVM-8041Q)
2,500,001–2,519,100 (PVM-8041Q)
2,000,001–2,001,300 (PVM-8043MD)
2,000,001–2,008,100 (PVM-8044Q)
2,500,001–2,511,700 (PVM-8044Q)

DESCRIPTION

Static electricity on the DY shield may cause horizontal noise to be displayed. To correct this condition perform the following modification.

MODIFICATION PROCEDURE

Fit a ground strap between the DY shield and the center frame as shown in Figure 1.

PARTS REQUIRED

Part No.	Description	Qty.
1-923-511-84	Ground Strap (18 AWG)	1

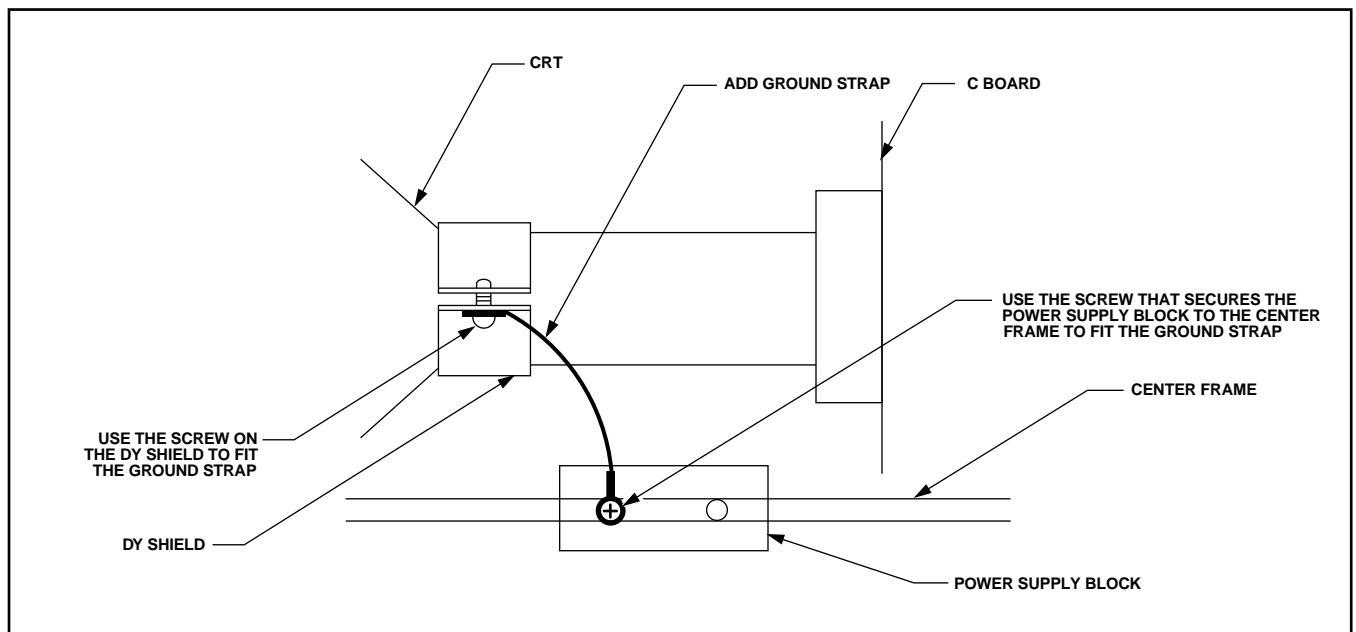


Figure 1