

Display

Date: **April 6, 1992**

Subject: **D2 BOARD MODIFICATION**

Model: **PVM-3230**

Serial No: **2,000,001-2,000,800**

DESCRIPTION

To improve the reliability of D2507 on the D2 board in a high temperature environment, replace R2550 as shown in Figure 1.

PARTS REQUIRED

Part No.	Description	Qty.
1-215-890-11	Res, Metal, 470Ω, 2W	1

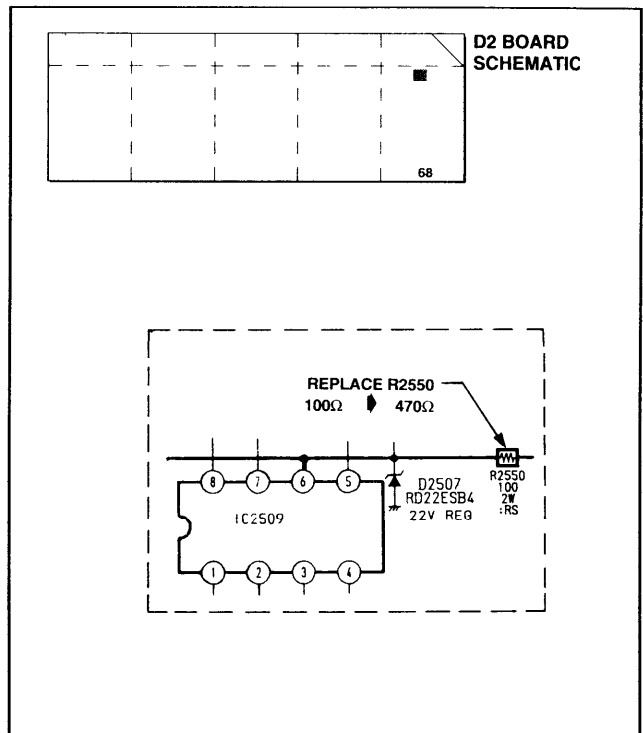


Figure 1