

**Display**

Date: **September 7, 1992**

Subject: **CORRECTING AUDIO JACK DEFORMATION**


Model: **PVM-8040/8041Q/8044Q**

Serial No: **2,001,801 AND HIGHER (PVM-8040)**  
**2,001,501 AND HIGHER (PVM-8041Q)**  
**2,000,901 AND HIGHER (PVM-8044Q)**


**DESCRIPTION**

The insulating material for the audio jack on the Input-Output Terminal board may have become slightly deformed by the heat generated during production. In extreme cases, it may become difficult or impossible to insert the audio pin into the audio jack. To correct this problem, new Input-Output Terminal boards for line A and line B connectors are now available. (See Figures 1 and 2.) The new part numbers are as follows.

- PVM-8040  
 Input-Output Terminal Board  
 1-537-411-11
- PVM-8041Q/8044Q  
 Input-Output Terminal Board (Line A)  
 1-537-410-11  
  
 Input-Output Terminal Board (Line B)  
 1-537-408-11

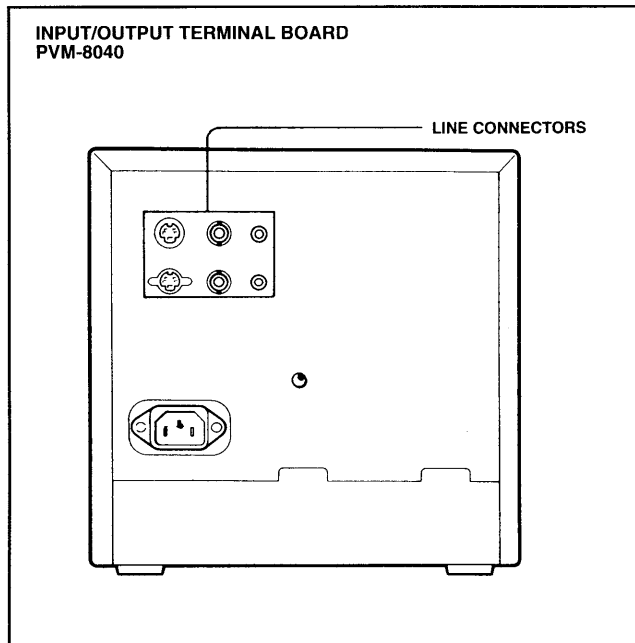

**Figure 1**

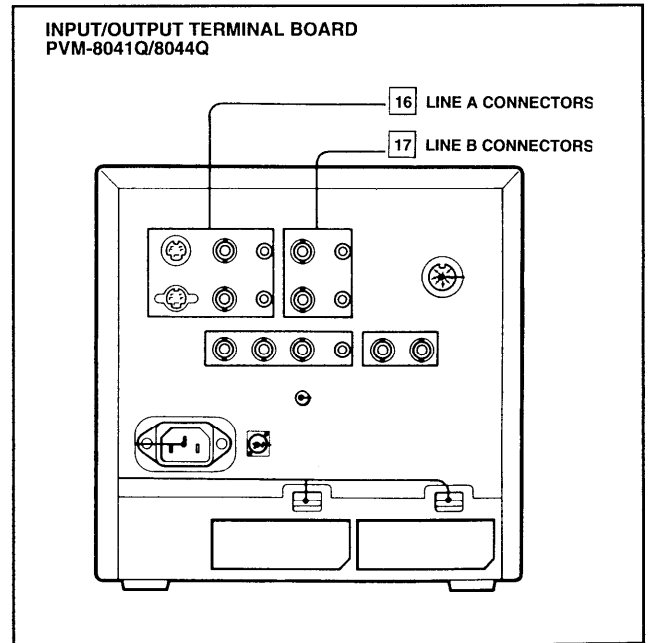

**Figure 2**