

Sony Electronics Inc.
Business and Professional Products Group
Technical Publications
3300 Zanker Road, San Jose, California 95134

Display

Date: **September 27, 1993**

Subject: **NEW EXTERNAL POWER JACK**

Model: **BVM-8021**

Serial No: **ALL**

DESCRIPTION

If a battery other than an BP-90 or BP-90A is used, the positive side terminal of the external power jack may contact the chassis, thereby causing excessive current to flow from the battery.

To prevent this from occurring, replace the external power jack with the high-shock resistant one and add insulation tape to the bottom of the jack to isolate it from the FB block.

PARTS REQUIRED

Part No.	Description	Qty.
1-507-465-21	External Power Jack, High-Shock Resistant	1

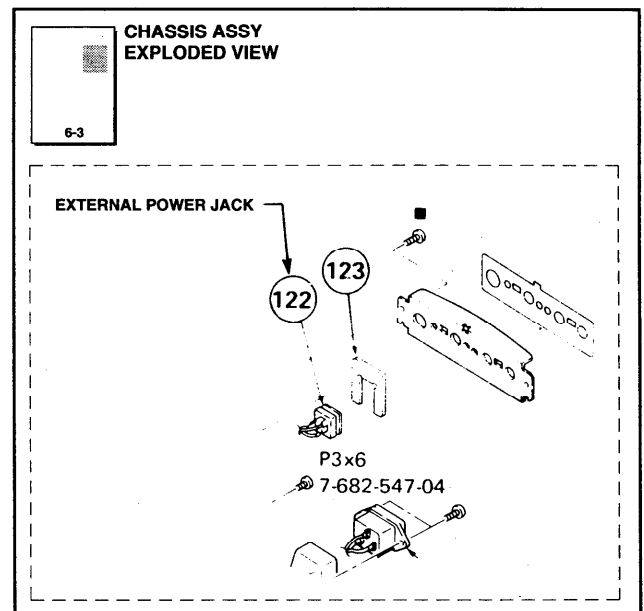


Figure 1