



Broadcast Products Technical Bulletin 20-2003-091

DATE: **March 24, 2003**

SUBJECT: **PICTURE DISTURBANCE AND GREEN PICTURE**

MODEL: **BKM-21D**

DESCRIPTION

SERIAL NO:

If C97 comes into contact with TP305, severe picture disturbance may occur and the picture may turn green.

BKM-21D 2,100,001-2,101,550

MODIFICATION PROCEDURE

BD Board (Side A, Zone B-1)

Remove TP305 if it is mounted,
or

(See Figure 1.)

Use RTV to hold C97 away from TP305 as follows:

1. Reposition C97 perpendicular to the board or approximately 10° away from TP305.
2. Apply RTV to C97 and TP305 as shown in Figure 1.

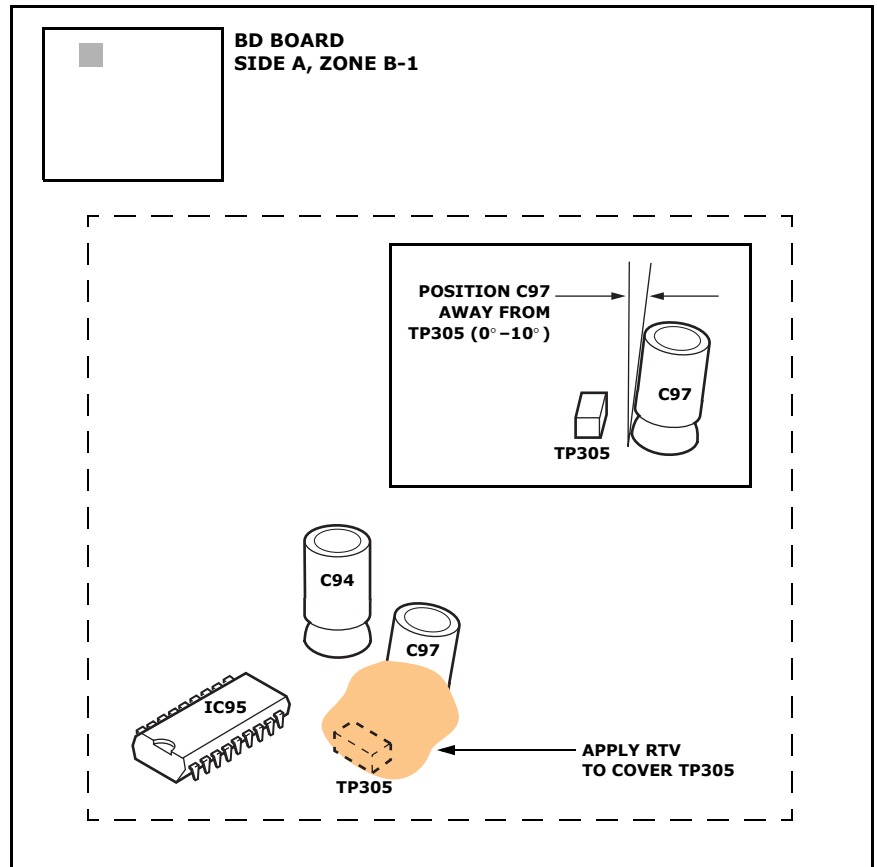


Figure 1

DPMO02-043