



Display

Video Products Technical Bulletin 30-2005-023

DATE: April 11, 2005

SUBJECT: NO PICTURE IF ANODE CAP COMES OFF

MODEL: ***PVM-9L1***
PVM-9L1**DESCRIPTION**

If the anode cap comes off, the picture will not appear. This symptom may occur with new monitors.

SERIAL NO:

PVM-9L1 *6,500,001–6,500,036*
PVM-9L1 6,200,001–6,204,357

MODIFICATION PROCEDURE

Check the attachment of the anode cap as follows:

1. Insert a card or equivalent under the anode cap. (See Figure 1.)

Italicized information in green applies to customers outside the United States.

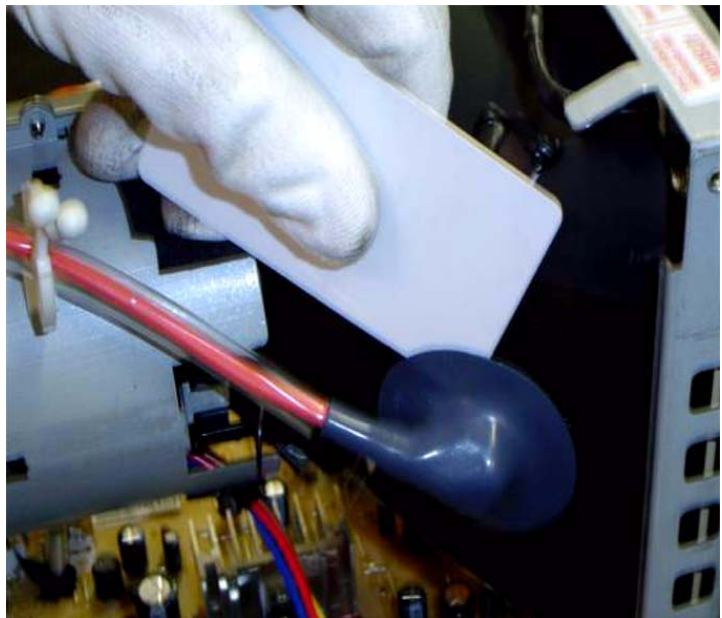


Figure 1

DPM004-051

2. Turn over the anode cap to check that both locking clips are inserted securely into the anode button of the CRT. (See Figure 2.)

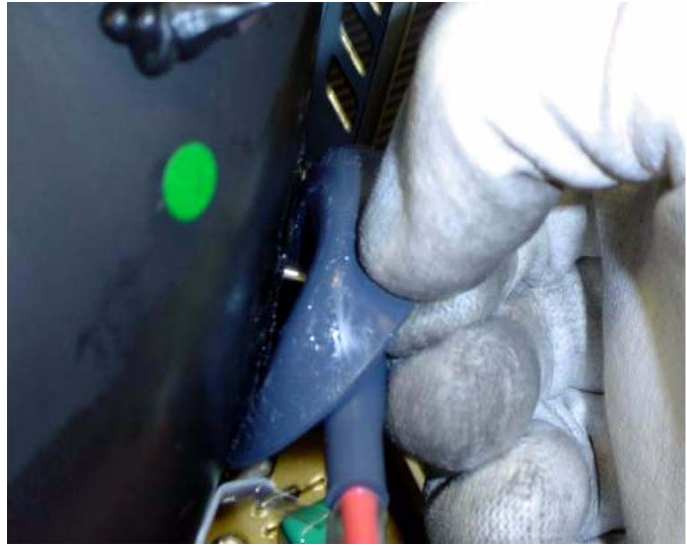


Figure 2

3. If the clips are not inserted securely, insert them.
4. Confirm that the anode cap is attached securely by pushing and pulling it. (See Figure 3.)

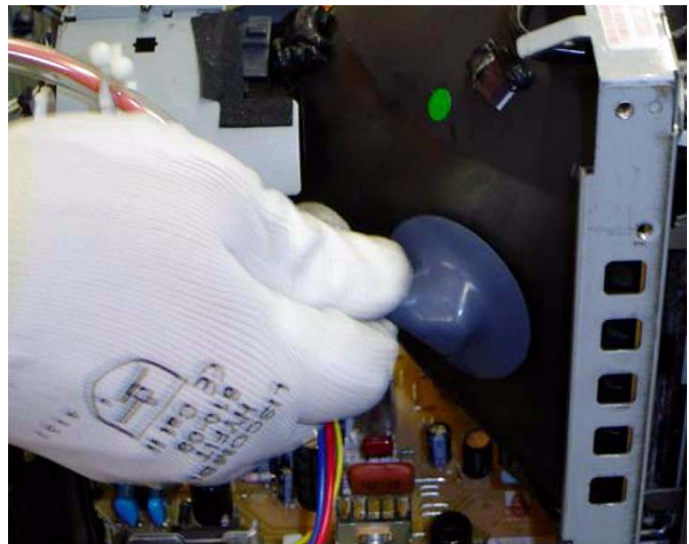


Figure 3